



Septic System Compliance Inspection – Existing System

Date: 7/20/23

Property Owner: Johnson, Tim & Brenda

Ordered By: Johnson, Tim

Address: 19086 484th Street McGregor, MN 55760

Property ID#: 29-1-163401

Inspector: Raini Kohl

A compliance inspection was performed at the above location. Soil evaluation was conducted to determine the level of seasonal saturated soil. The Soil Treatment Area (Drain field) was also inspected to ensure there was no ponding or leaking. The septic tank was pumped and inspected. This onsite system was found to be **Compliant**.

- **Impact On Public Health:**
System is Compliant
- **Tank Integrity:**
Tank(s) are compliant
- **Other Compliance Conditions:**
None
- **Soil Separation**
Soils are compliant
- **Operating Permit and Nitrogen BMP**
NA

I have included a copy of the compliance documents for your record. I have also sent a copy to Aitkin County for their records. If you have any questions, please do not hesitate to give us a call.

Thanks!

Tim Woodrow
Owner

218-927-6175

218-927-6175

1037 1st St. NW Aitkin, MN 56431

WWW.TIMBERLAKESSEPTIC.COM



DISCLAIMER:

The septic system inspection conducted for this property meets MPCA requirements for existing systems.

We recommend this system to be serviced and evaluated at least every 36 months by a septic professional.

Any additions to the home or increased use of the home may require an increase in system capacity.

1. Compliance Requirements evaluated as part of this inspection include the verification that the system tanks do not leak below the designed operating depth, the required separation between the bottom of the subsurface distribution medium and the seasonally saturated soils if applicable, no discharge of septage/effluent to the ground surface or surface water and no imminent safety hazards exist. Timber Lakes Septic Inc does not inspect interior pumps, plumbing, or associated components.
2. Certification of this system does not warranty future use beyond the date of inspection. Any system, new or old, can be hydraulically overloaded and discharge to ground surface as a result of increase use (more people in house, faulty plumbing fixtures, change in habits, groundwater infiltration etc), improper maintenance, tree roots, freezing conditions, surface drainage problems, etc. The system can also stop working simply due to its age. The life expectancy of a system is variable and dependent upon the items previously listed. Proper maintenance and water conservation will help contribute to a longer system life.
3. A compliance inspection is not meant to be a test or inspection of longevity of the system. A compliance inspection is for the purpose of verifying if the system is protective of public health and safety as well as protecting the ground water at the date and time the inspection was performed. This inspection is not intended to determine if the system was originally designed or installed to past or present MPCA/Local Government Unit Code requirements. This inspection is not intended to determine if the system was designed and/or installed to support the anticipated flow from buildings as the use of the buildings may have changed since the original design was completed. These changes may include additional bedrooms, occupants, increased use, etc. In addition, this inspection is not intended to determine the quality of the original system design, quality of the construction practices during installation, or quality of materials used.
4. Timber Lakes Septic Inc. has not been retained to warranty, guarantee, or certify the proper functioning of the ISTS system for any period of time beyond the date of inspection or into the future. There are numerous factors which may affect the proper operation of a ISTS System and the inability of Timber Lakes Septic to supervise or monitor the use or maintenance of the ISTS System, the Compliance Report shall not be construed as a warranty or guarantee of future system performance.
5. By accepting this report, the client understands that Timber Lakes Septic will not be responsible for any monetary damages exceeding the fee for services provided.
6. This Report is prepared for the person or rep of the person providing payment for the fees charged.

Instructions: Inspector must submit completed form to Local Governmental Unit (LGU) and system owner within 15 days of final determination of compliance or noncompliance. Instructions for filling out this form are located on the Minnesota Pollution Control Agency (MPCA) website at <https://www.pca.state.mn.us/sites/default/files/wq-wwists4-31a.pdf>.

Property information

Local tracking number: _____

Parcel ID# or Sec/Twp/Range: 29-1-163401 Reason for Inspection Permit

Local regulatory authority info: Aitkin County

Property address: 19086 484th Street McGregor, MN 55760

Owner/representative: Tim Johnson Owner's phone: 651-238-6363

Brief system description: 1000/350 septic and lift combo to a 10'x40' pressure bed.

System status

System status on date (mm/dd/yyyy): 7/20/2023

Compliant – Certificate of compliance*

Noncompliant – Notice of noncompliance

(Valid for 3 years from report date unless evidence of an imminent threat to public health or safety requiring removal and abatement under section 145A.04, subdivision 8 is discovered or a shorter time frame exists in Local Ordinance.)

Systems failing to protect ground water must be upgraded, replaced, or use discontinued within the time required by local ordinance.

An imminent threat to public health and safety (ITPHS) must be upgraded, replaced, or its use discontinued within ten months of receipt of this notice or within a shorter period if required by local ordinance or under section 145A.04 subdivision 8.

***Note: Compliance indicates conformance with Minn. R. 7080.1500 as of system status date above and does not guarantee future performance.**

Reason(s) for noncompliance (check all applicable)

- Impact on public health (Compliance component #1) – *Imminent threat to public health and safety*
- Tank integrity (Compliance component #2) – *Failing to protect groundwater*
- Other Compliance Conditions (Compliance component #3) – *Imminent threat to public health and safety*
- Other Compliance Conditions (Compliance component #3) – *Failing to protect groundwater*
- System not abandoned according to Minn. R. 7080.2500 (Compliance component #3) – *Failing to protect groundwater*
- Soil separation (Compliance component #5) – *Failing to protect groundwater*
- Operating permit/monitoring plan requirements (Compliance component #4) – *Noncompliant - local ordinance applies*

Comments or recommendations

Certification

I hereby certify that all the necessary information has been gathered to determine the compliance status of this system. No determination of future system performance has been nor can be made due to unknown conditions during system construction, possible abuse of the system, inadequate maintenance, or future water usage.

By typing my name below, I certify the above statements to be true and correct, to the best of my knowledge, and that this information can be used for the purpose of processing this form.

Business name: Timber Lakes Septic Service Certification number: C2703

Inspector signature: Raini Kohl License number: L455

(This document has been electronically signed) Phone: 218-927-6175

Necessary or locally required supporting documentation (must be attached)

- Soil observation logs
- System/As-Built
- Locally required forms
- Tank Integrity Assessment
- Operating Permit
- Other information (list): _____

Property Address: 19086 484th Street McGregor, MN 55760

Business Name: Timber Lakes Septic Service

Date: 7/20/2023

1. Impact on public health – Compliance component #1 of 5

Compliance criteria:

System discharges sewage to the ground surface Yes* No

System discharges sewage to drain tile or surface waters. Yes* No

System causes sewage backup into dwelling or establishment. Yes* No

Any "yes" answer above indicates the system is an imminent threat to public health and safety.

Describe verification methods and results:

Attached supporting documentation:

Other: _____

Not applicable

2. Tank integrity – Compliance component #2 of 5

Compliance criteria:

System consists of a seepage pit, cesspool, drywell, leaching pit, or other pit? Yes* No

Sewage tank(s) leak below their designed operating depth? Yes* No

If yes, which sewage tank(s) leaks:

Any "yes" answer above indicates the system is failing to protect groundwater.

Describe verification methods and results:

Attached supporting documentation:

Empty tank(s) viewed by inspector

Name of maintenance business: _____

License number of maintenance business: _____

Date of maintenance: _____

Existing tank integrity assessment (Attach)

Date of maintenance 7/14/2023

(mm/dd/yyyy):

(must be within three years)

(See form instructions to ensure assessment complies with Minn. R. 7082.0700 subp. 4 B (1))

Tank is Noncompliant (pumping not necessary – explain below)

Other: _____

3. Other compliance conditions – Compliance component #3 of 5

3a. Maintenance hole covers appear to be structurally unsound (damaged, cracked, etc.), or unsecured?

Yes* No Unknown

3b. Other issues (*electrical hazards, etc.*) to immediately and adversely impact public health or safety? Yes* No Unknown

**Yes to 3a or 3b - System is an imminent threat to public health and safety.*

3c. System is non-protective of ground water for other conditions as determined by inspector?

Yes* No

3d. System not abandoned in accordance with Minn. R. 7080.2500?

Yes* No

**Yes to 3c or 3d - System is failing to protect groundwater.*

Describe verification methods and results:

Attached supporting documentation: Not applicable

4. Operating permit and nitrogen BMP* – Compliance component #4 of 5 Not applicable

Is the system operated under an Operating Permit?

Yes No **If “yes”, A below is required**

Is the system required to employ a Nitrogen BMP specified in the system design? Yes No

If “yes”, B below is required

BMP = Best Management Practice(s) specified in the system design

If the answer to both questions is “no”, this section does not need to be completed.

Compliance criteria:

a. Have the operating permit requirements been met?

Yes No

b. Is the required nitrogen BMP in place and properly functioning?

Yes No

Any “no” answer indicates noncompliance.

Describe verification methods and results:

Attached supporting documentation: Operating permit (Attach)

5. Soil separation – Compliance component #5 of 5

Date of installation 11/17/1985 Unknown
(mm/dd/yyyy)

Shoreland/Wellhead protection/Food beverage lodging? Yes No

Compliance criteria (select one):

5a. For systems built prior to April 1, 1996, and not located in Shoreland or Wellhead Protection Area or not serving a food, beverage or lodging establishment: Yes No*

Drainfield has at least a two-foot vertical separation distance from periodically saturated soil or bedrock.

5b. Non-performance systems built April 1, 1996, or later or for non-performance systems located in Shoreland or Wellhead Protection Areas or serving a food, beverage, or lodging establishment: Yes No*

Drainfield has a three-foot vertical separation distance from periodically saturated soil or bedrock.*

5c. "Experimental", "Other", or "Performance" systems built under pre-2008 Rules; Type IV or V systems built under 2008 Rules 7080.2350 or 7080.2400 (Intermediate Inspector License required ≤ 2,500 gallons per day; Advanced Inspector License required > 2,500 gallons per day) Yes No*

Drainfield meets the designed vertical separation distance from periodically saturated soil or bedrock.

Attached supporting documentation:

- Soil observation logs completed for the report
- Two previous verifications of required vertical separation
- Not applicable (No soil treatment area)
- _____

Indicate depths or elevations

A. Bottom of distribution media	100
B. Periodically saturated soil/bedrock	Below 97.0
C. System separation	>36"
D. Required compliance separation*	31"

*May be reduced up to 15 percent if allowed by Local Ordinance.

**Any "no" answer above indicates the system is failing to protect groundwater.*

Describe verification methods and results:

Upgrade requirements: (Minn. Stat. § 115.55) An imminent threat to public health and safety (ITPHS) must be upgraded, replaced, or its use discontinued within ten months of receipt of this notice or within a shorter period if required by local ordinance. If the system is failing to protect ground water, the system must be upgraded, replaced, or its use discontinued within the time required by local ordinance. If an existing system is not failing as defined in law, and has at least two feet of design soil separation, then the system need not be upgraded, repaired, replaced, or its use discontinued, notwithstanding any local ordinance that is more strict. This provision does not apply to systems in shoreland areas, Wellhead Protection Areas, or those used in connection with food, beverage, and lodging establishments as defined in law.

Sewage tank integrity assessment form

Subsurface Sewage Treatment Systems (SSTS) Program

Doc Type: Compliance and Enforcement

Purpose: This form *may* be used to certify the compliance status of the sewage tank components of the SSTS. **This form is not a complete SSTS inspection report, only a tank integrity assessment, and may only certify sewage tank compliance status when entirely completed and signed by a qualified professional.** SSTS compliance inspection report forms can be found at: <https://www.pca.state.mn.us/water/inspections>.

Instructions: This form may be completed, and signed, by a Designated Certified Individual (DCI) of a licensed SSTS inspection, maintenance, installation, or service provider business who personally conducts the necessary procedures to assess the compliance status of each sewage tank in the system. Only a licensed maintenance business is authorized to pump the tank for assessment. A copy of this information should be submitted to the system owner and be maintained by the licensed SSTS business for a period of five (5) years from the assessment date.

When this form is signed by a qualified certified professional, it becomes *necessary supporting documentation* to an Existing System Compliance Inspection Report: [Compliance inspection form - Existing system \(wq-wwists4-31b\)](#). This form can be found on the MPCA website at <https://www.pca.state.mn.us/water/inspections>.

The information and certified statement on this form is **required** when existing septic tank compliance status is determined by an individual other than the SSTS Inspector that submits an inspection report. This form represents a third party assessment of SSTS component compliance and is allowable under Minn. R. 7082.0700, subp. 4(B)(1). This form is valid for a period of three years beyond the signature date on this form unless a new evaluation is requested by the owner or owner's agent or is required according to local regulations. Additional Administrative Rule references for this activity can be found at Minn. R. 7082.0700, subp. 4(B),(C), and (D) and; Minn. R. 7083.0730(C).

Owner information

Owner/Representative Johnson, Tim
Property address: 19086 484th St., McGregor, MN 55760
Local Regulatory Authority: Aitkin County Parcel ID: 29-1-163401

System status

System status on date (mm/dd/yyyy): 7/14/2023

Certificate of sewage tank compliance

Notice of sewage tank non-compliance

Compliance criteria:

The SSTS has a seepage pit, cesspool, drywell, leaching pit, or other pit - "Failure to Protect Groundwater."	<input type="checkbox"/> Yes* <input checked="" type="checkbox"/> No
The SSTS has a sewage tank that leaks below the designed operating depth - "Failure to Protect Groundwater."	<input type="checkbox"/> Yes* <input checked="" type="checkbox"/> No
The SSTS presents a threat to public safety by reason of structurally unsound (damaged, cracked, or weak) maintenance hole cover(s) or lids or any other unsafe condition - "Imminent Threat to Public Health or Safety."	<input type="checkbox"/> Yes* <input checked="" type="checkbox"/> No

Any "yes" answer above indicates sewage tank non-compliance.

Company information

Company name: Timber Lakes Septic Service Inc
Business license number: L455

Designated Certified Individual (DCI) information

Print name: Dan Swanson
Certification number: C6023


I personally conducted the work described above as a Designated Certified Individual of a Minnesota-licensed SSTS inspection, maintenance, installation, or service provider Business. I personally conducted the necessary procedures to assess the compliance status of each sewage tank in this SSTS.

By typing/signing my name below, I certify the above statements to be true and correct, to the best of my knowledge, and that this information can be used for the purpose of processing this form.

Designated Certified Individual's signature: Dan Swanson Date (mm/dd/yyyy): 7/14/2023
(This document has been electronically signed.)

SKETCH SHEET AND SOIL BORING LOG

INSPECTOR: Raini Kohl
DATE: 7/20/23
PID#: 29-1-163401
SITE ADDRESS: 19086 484th St McGregor, MN 55760
Equipment: Bucket Auger
Elevation of Limiting Layer: Below 97.0'
Vegetation: Mowed Grass
Weather: Sunny & Clear
Benchmark (EL = 100'): Bottom of Rock in STA

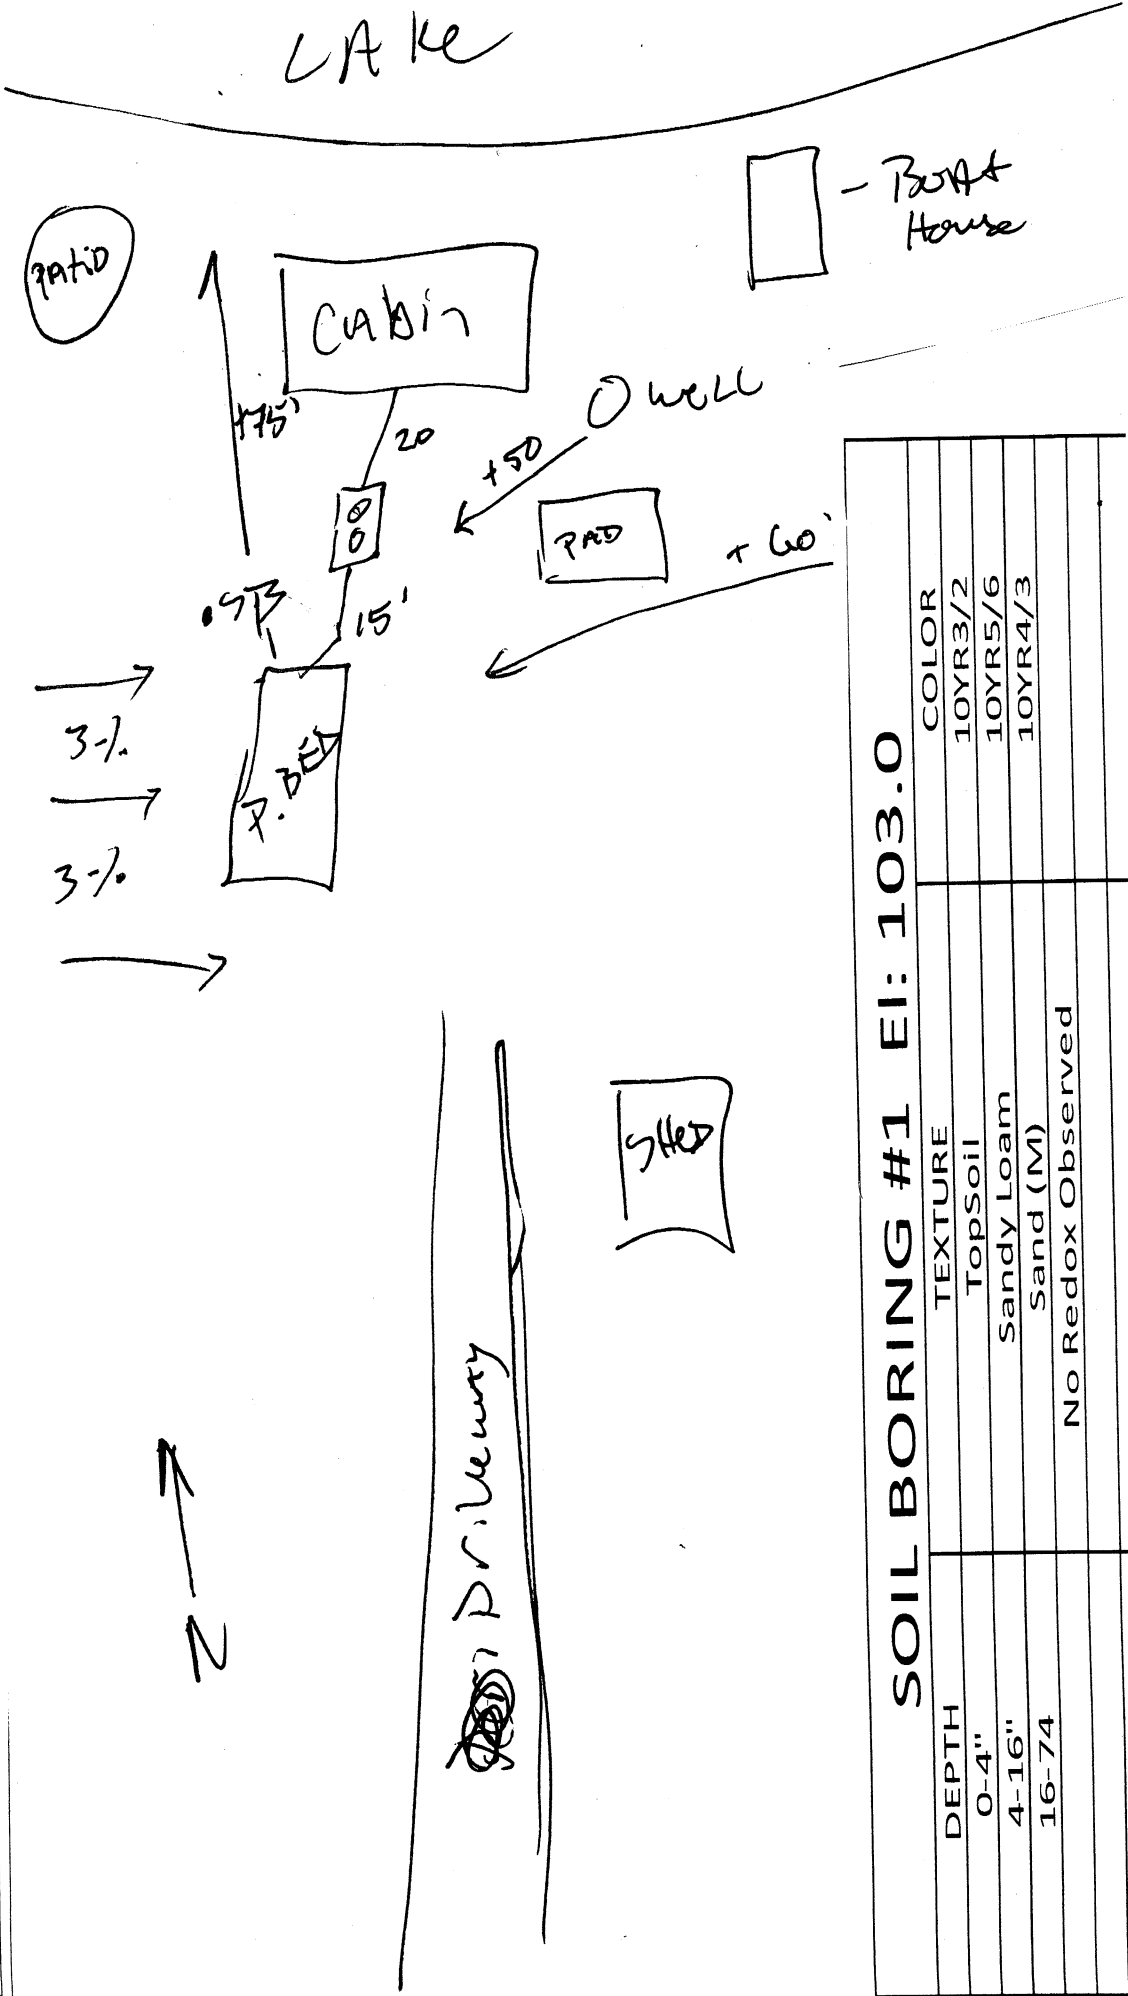

SOIL BORING #1 EI: 103.0

DEPTH	TEXTURE	COLOR
0-4"	Top Soil	10YR3/2
4-16"	Sandy Loam	10YR5/6
16-74"	Sand (M)	10YR4/3
	No Redox Observed	